DETAILS OF INSPECTION VIOLATIONS

NO. LOCATION CRITICAL DESCRIPTION REF. POINTS POTABLE WATER 08 Λ Nο THE DISINFECTION PROCEDURES FOR THE WATER TANKS WERE NOT DOCUMENTED. Corrective Action: Consistent documentation of the disinfect ion procedures implemented. **POTABLE WATER** 07 Yes THE VESSEL HAS 10 POTABLE WATER TANKS. ALL OF THE TANKS SHARE A WALL WITH THE HULL OF THE VESSEL. A LETTER HAS BEEN WRITTEN TO VSP REQUESTING A VARIANCE FOR THIS SHIP. Corrective Action: A variance letter was sent to CDC Vessel Sanitation Program to the attention of Chief David Forney on October 1, 2003 through IMCL office. TRATTORIA SERVICE AREA 33 1 No UTILITY/DRAIN LINES DRAPED THE DECK MAKING CLEAN DIFFICULT. Corrective Action: Utility drain lines secured to create enough space between the deck and the lines. TRATTORIA SERVICE AREA 33 1 No THE DECK WAS SOILED UNDERNEATH COOKING EQUIPMENT AND PREPARATION COUNTERS. Corrective Action: The deck is cleaned and will maintain cleanliness. TRATTORIA SERVICE AREA 21 1 No ROUGH WELDS WERE NOTED INSIDE THE DRIP PAN HOUSING OF THE FLAT TOP GRILL. Corrective Action: The welding was grounded making it easily cleanable. TRATTORIA SERVICE AREA 20 Nο THE CONTAINER FOR THE PLASTIC WRAP WAS MADE OUT OF CARDBOARD. Corrective Action: Cardboard was replaced with stainless steel holder. TRATTORIA SERVICE AREA Yes THE CARDBOARD CONTAINER FOR THE PLASTIC WRAP WAS SLIGHTLY SOILED WITH A FOOD RESIDE. Corrective Action: Cardboard box was discarded and replaced with stainless steel holder which we maintain cleanliness. TRATTORIA SERVICE AREA No THE SEAM ON THE RIGHT SIDE OF THE FLAT TOP GRILL WAS SOILED WITH A GREASY FOOD RESIDE. Corrective Action: The seam was cleaned and instructions given to crewmember on duty in maintaining proper cleaning procedures. TRATTORIA SERVICE AREA 33 1 No A GAP WAS NOTED ON THE RIGHT SIDE OF THE PREPARATION COUNTER BETWEEN THE SPLASH GUARD AND THE BULKHEAD. Corrective Action: The gap of the preparation counter was covered all around with stainless steel flat bar. TRATTORIA BEVERAGE STATION 26 n Yes THE CUP DISPENSERS WERE SLIGHTLY SOILED WITH FOOD DEBRIS.

Corrective Action: The cup dispensers are now covered with stainless steel cover whenever empty.

Also instructions given to crewmember on duty in maintaining proper cleaning procedures.

TRATTORIA - POT WASH 24 Yes THERE WAS NO CHLORINE RESIDUAL IN THE SANITIZE COMPARTMENT. Corrective Action: The sanitizing compartment was used only for pre-washing. Sign to this effect already installed. TRATTORIA - DISH WASH 22 0 Nο THE CURRENT DATA PLATE IS NOT ACCURATE FOR THIS MACHINE. THIS UNIT USES HOT WATER SANITIZE WHILE THE DATA PLATE SPECIFIES A CHLORINE SANITIZER. Corrective Action: The proper data plate was installed. **MERMAID BAR PANTRY** 22 No THE DATA PLATE DID NOT CONTAIN THE INFORMATION NEEDED FOR THIS MACHINE. Corrective Action: The proper data plate was installed. **MERMAID BAR** 26 Yes A BRASS FIXTURE WAS NOTED BETWEEN THE BACKFLOW PREVENTER AND THE CARBONATOR. Corrective Action: Stainless steel fixture was installed in lieu of the brass. 15 MERMAID BAR PANTRY 33 1 No THE TILING DID NOT COVER THE ENTIRE DECK UNDERNEATH THE COUNTER. Corrective Action: Tiles were laid to cover the entire deck underneath the counter. **MERMAID BAR** 33 16 1 Nο ELECTRICAL CORDS DRAPED THE DECK MAKING CLEANING DIFFICULT. Corrective Action: Electrical cords were fastened, making the area easily cleanable. **BAR GENERAL** 21 1 No GAPS WERE NOTED AROUND BAR EQUIPMENT. Corrective Action: Gaps were covered around bar equipments FOOD SERVICE GENERAL 21 No GAPS, HOLES AND OPEN SEAMS WERE NOTED ON THE NON-FOOD CONTACT SURFACES THROUGHOUT THE FOOD SERVICE AREAS MAKING CLEANING DIFFICULT. Corrective Action: Repairing the various deficiencies as well as possible. 19 FOOD SERVICE GENERAL 33 Nο RECESSED GROUT, BROKEN/MISSING DECK TILES WERE NOTED ON THE DECKS THROUGHOUT THE FOOD SERVICE AREAS. Corrective Action: Grouting took place, and broken/missing tiles replaced/laid. **FOOD SERVICE GENERAL** 33 No GAPS AND OPEN SEAMS WERE NOTED ON THE DECK HEADS AND BULKHEADS THROUGHOUT THE FOOD SERVICE AREAS. Corrective Action: Repairing the various deficiencies as well as possible.. 21 **MAIN GALLEY** 26 0 Yes

Corrective Action: We will ensure separation. Instructions on proper cleaning procedures was given to the crewmember on duty.

A SOILED CHEESE GRATER WAS STORED AS CLEAN.

22 MAIN GALLEY 20 2 No

THE BLAST CHILLER WAS TAGGED OUT OF ORDER. THIS IS A CRITICAL PIECE OF EQUIPMENT FOR THE GALLEY TO ENSURE THAT PROPER COOLING TECHNIQUES FOR FOODS ARE FOLLOWED.

Corrective Action: A new blast chiller was ordered.

23 MAIN GALLEY 20 2 No

THE MEAT SLICER HAD SOFT SEALANT APPLIED ALONG FOOD-CONTACT SURFACES OF THE EQUIPMENT.

Corrective Action: Soft sealant was discarded and replaced with hard sealant.

24 FOOD SERVICE GENERAL

27 1 No

NON-FOOD CONTACT SURFACES THROUGHOUT THE FOOD SERVICE AREA WERE SOILED.

Corrective Action: The area has been cleaned and the proper cleaning procedures were given to crewmembers on duty.

25 PROVISIONS-BUTCHER SHOP

20 2 No

TWO CUTTING BOARDS WERE FOUND HEAVILY SCRATCHED AND PITTED.

Corrective Action: Cutting boards were discarded and replaced with new ones.

26 MAIN GALLEY-WARE WASHER

37 1 No

EXCESSIVE HEAT AND CONDENSATION ON THE DECK HEAD WAS NOTED IN THE WARE WASHER AREA.

Corrective Action: Air flow was increased.

27CORRECTIVE ACTION STATEMENT

* 0 No

IN DEVELOPING THE CORRECTIVE ACTION STATEMENT FOR THIS INSPECTION, CRITICAL-ITEM DEFICIENCIES (DESIGNATED WITH YES IN CRITICAL COLUMN (WORTH 3 - 5 POINTS), WHETHER DEBITED OR NOT, SHOULD INCLUDE STANDARD OPERATING PROCEDURES AND MONITORING PROCEDURES IMPLEMENTED TO PREVENT THE RECURRENCE OF THE CRITICAL DEFICIENCY. PREPARE CORRECTIVE ACTION STATEMENT AS A WORD PROCESSING OR SPREADSHEET FILE WHICH WILL BE SENT TO USPHS / VSP AS AN EMAIL MESSAGE ATTACHMENT. PLEASE EMAIL CORRECTIVE ACTION STATEMENT TO: VSP@CDC.GOV